AD A 092 351 TECHNICAL LIBRARY

AD		

TECHNICAL REPORT ARBRL-TR-02265

HEAT TRANSFER MEASUREMENTS IN 105 MM TANK GUN WITH M735 ROUNDS

Irvin C. Stobie
Timothy L. Brosseau
Robert P. Kaste

September 1980



US ARMY ARMAMENT RESEARCH AND DEVELOPMENT COMMAND BALLISTIC RESEARCH LABORATORY ABERDEEN PROVING GROUND, MARYLAND

Approved for public release; distribution unlimited.

Destroy this report when it is no longer needed. Do not return it to the originator.

Secondary distribution of this report by originating or sponsoring activity is prohibited.

Additional copies of this report may be obtained from the National Technical Information Service, U.S. Department of Commerce, Springfield, Virginia 22151.

The findings in this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.

The use of trade names or manufacturers' names in this report does not constitute indorsement of any commercial product.

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Date Entered)

REPORT DOCUMENTATION	PAGE	READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
TECHNICAL REPORT ARBRL-TR-02265		
4. TITLE (and Subtttla)		5. TYPE OF REPORT & PERIOD COVERED
HEAT TRANSFER MEASUREMENTS IN 105 m M735 ROUNDS	m TANK GUN WITH	RRI. Technical Report 6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(e)		8. CONTRACT OR GRANT NUMBER(*)
Irvin C. Stobie Timothy L. Brosseau Robert P. Kaste	2:	
9. PERFORMING ORGANIZATION NAME AND ADDRESS U.S. Army Armament Research and Dev U.S. Army Ballistic Research Labora ATTN: DRDAR-BLP Aberdeen Proving Ground, MD 21005	elopment Command tory	10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS 1L162618AH80
II. CONTROLLING OFFICE NAME AND ADDRESS		12. REPORT DATE
U.S. Army Armament Research and Dev U.S. Army Ballistic Research Labora	elopment Command	SEPTEMBER 1980
ATTN: DRDAR-BL	.to1 y	13. NUMBER OF PAGES
Aberdeen Proving Ground, MD 21005 14. MONITORING AGENCY NAME & ADDRESS(If different		24
14. MONITORING AGENCY NAME & ADDRESS(If differen	it from Controlling Office)	15. SECURITY CLASS. (of this report) UNCLASSIFIED
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report)		

6. DISTRIBUTION STATEMENT (of thie Report)

Approved for public release; distribution unlimited.

17. DISTRIBUTION STATEMENT (of the ebetract entered in Block 20, if different from Report)

18. SUPPLEMENTARY NOTES

19. KEY WORDS (Continue on reverse side if necessary and identify by block number)

Erosion

105 mm tank gun

M735

Wear reducing liners

Heat input

20. ABSTRACT (Continue on reverse side if necessary and identify by block number) (clt)

The heat input into an M68 cannon was measured using an imbedded thermocouple technique. M735, M392 and M490 rounds were evaluated with emphasis on the high loading density M735 rounds. Position, type, temperature and gluing techniques of wear reducing liners were evaluated. It was determined that the minimum tube life for the high loading density M735 rounds based on 1.91 mm (75 mil) condemnation criteria would be 220 rounds under the present configuration. This minimum number could be increased to 3820 rounds using techniques described in this report

DD 1 JAN 73 1473

EDITION OF 1 NOV 65 IS OBSOLETE

TABLE OF CONTENTS

																						Page
	LIST OF TABLE	ES		•	•		•	•								•		•	•	•	•	5
I.	INTRODUCTION			•	•	•	•	•	•	•			ı,					•	•	•		7
II.	EXPERIMENTAL	PROCED	URE	S	•	•	•	•	•	•	•	•	•	•		•	•	•	•		•	7
III.	ANALYSIS AND	RESULT	s.		•	•	•	•	•	•	•	•	•	•	•	•	•	٠	•	•	•	10
IV.	CONCLUSIONS				•	•	•	•		•	•	•	•	•	•	•	•	•	٠	•	•	18
	REFERENCES .				•	•						•				•	•	•	•	•	•	19
	DISTRIBUTION	LIST.						•														21

LIST OF TABLES

Ta	able	s	Page
	1.	PERTINENT AMMUNITION CHARACTERISTICS	9
	2.	FIRING DATA 105 mm HEAT TRANSFER	11
	3.	HEAT TRANSFER - M392 ROUNDS	13
	4.	M735 HEAT TRANSFER RESULTS 294°K	14
	5.	HEAT TRANSFER RESULTS 336°K	16
	6.	PREDICTED EROSION RATES FOR M735 (AT 641.4 mm RFT)	17
	7.	PREDICTED VS ACTUAL EROSION RATE (AT 641.4 mm RFT)	17

I. INTRODUCTION

Extensive evaluation of the measurement of heat input into a 105 mm M68 tank cannon has been done at BRL. 1, 2 The heat input was determined by measuring the change in temperature at four different radial positions in the tube wall at an axial distance of 641.4 mm from the rear face of the tube (RFT). The purpose of this test was to evaluate the total heat input of the M735 round at ambient (294°K) and elevated temperatures (336°K). The study was expanded to show the effect of position, technique of glue application, and type of wear reducing additive on the heat input. M392 and M490 rounds were also fired to correlate this test to previous testing. The heat input values have been applied to an empirical formula derived by Brosseau³ to infer an erosion rate. The measurements in this test were all made for the "worst case" situation for heat input. All measurement rounds were fired from a clean gun tube. The gun tube was pre-conditioned by firing M467 rounds before the measurement rounds to remove additive residue. It has been found that several additive rounds fired in succession are required to obtain minimum heat input values or "best case" situations.² The limited number of M735 rounds available for this test precluded the firing of "best case" series.

II. EXPERIMENTAL PROCEDURES

Heat transfer measurements were made in an M68 cannon with 77 per cent estimated remaining accuracy life.⁴ Four constantan wires, 0.13 mm diameter, were welded using a capacitive discharge technique to form constantan-gun steel thermocouples at 641.4 mm (RFT). The thermocouples were located over grooves at a position where vertical land diameter is measured to assess the remaining barrel life.⁵ The thermocouple locations are denoted below:

¹T. L. Brosseau and J. R. Ward, "Reduction of Heat Transfer in 105 mm Tank gun by Wear-Reducing Additives", BRL-MR-2698, Nov 1976.

⁽AD #B015308L)

2T. L. Brosseau and J. R. Ward, "Measurement of the Heat Input into the 105 mm M68 Tank Cannon Firing Rounds Equipped with With Wear-Reducing Additives", BRL-TR-02056, April, 1978. (AD #A056368)

³T. L. Brosseau, B. B. Grollman and J. R. Ward, "Empirical Formula Correlating Erosion and Heat Transfer", 1979 JANNAF Propulsion Meeting, Anaheim, CA, Vol 1 pp 231-250, March 1979.

 $^{^4}$ Based on star gaging data, 19 Oct 1979, tube No. 24849.

⁵"Evaluation of Cannon Tubes", Dept of Army Technical Manual, TM-9-1000-202-35, Nov 1969.

·	,	Distance from
Thermocouple No.	Position	Bore Surface (mm)
1	3 O'clock	0.73
2	9 0'clock	0.98
3	6 O'clock	1.37
4	12 0'clock	2.50

Table 1 summarizes pertinent characteristics of the ammunition fired in the test series. The gluing of liners in the "as received" liner rounds consists of the application of an approximately 25 mm wide band of glue to the inside perimeter of the liner and applying the liner to the appropriate position inside the cartridge case. The reglued liners consist of application of the glue to the entire inside area of the liner as well as to the effected area of the case. The glue used in both applications was 3M adhesive No. EC 1099. The talc/wax and the TiO2/wax liners were approximately 375 mm long, 230 mm wide, and 1.5 mm thick for the below the neck applications. A right triangular portion of the liners, reducing the area by 6.4%, was removed for "at the neck" cases to prevent overlap. The average mass of the TiO2/wax liners was 132 g and the average mass of the talc/wax liner was 141 g. The positions of the liners is shown in Figure 1.

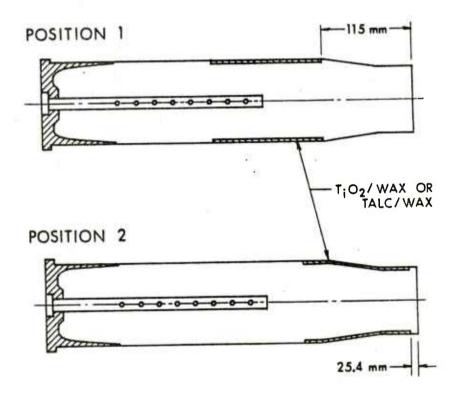


Figure 1. Liners and Positions for M735 Rounds

TABLE 1. PERTINENT AMMUNITION CHARACTERISTICS

		Propellant			Projectile		Muzz1e	1e	Chamber
Round	Type	Web, mm	Mass, kg	Type	Mass, kg	Primer	Veloci	Velocity, m/s	Pressure, MPa
M392A2 APDS_T	M30	1.16 MP	5.602	M392E3	5.874	M80A1	@63°C @21°C	1546 ⁷ 1486	475/
(LOT MA-11-3A) (LOT MA-11-7A)	11-3A) 11-7A)								
M467	M1	.086 MP	2.744	M468	11.25	M86		731.9	166
(LOT-MA-30-29)	30-29)						•	7	7
M735	M30	1.17 MP	6.046	M735	5.788	M148A1B1	@ 63° C @2 1° C	1590' 1506	486° 403
APDSFS-T (LOT MA77	(LOT MA7TE000E187								
M490 TP-T	M30	1.35 MP	3.242	M489	10.138	M148A1B1		1174	410

 6 Artillery Ammunition Master and Reference Chart", TECOM Report No. 1375, Nineteenth Revision, June 1978

Private communication with J. O. Pilcher, BRL, September 1979.

The rounds were conditioned at a constant temperature of either 294°K or 336°K for twenty-four hours prior to firing. The thermocouple responses were amplified using Newport 70 amplifiers and simultaneously recorded on a Honeywell 96 analog tape recorder and a digital ballistic data acquistion system.

III. ANALYSIS AND RESULTS

The firing sequence is reported in Table 2. Using a calibration factor of $52~\mu\text{V/K}$, the thermocouple outputs were compared to voltage calibration steps to determine the change in temperature. A typical temperature time plot obtained from the ballistic data acquistion system is shown in Figure 2. Using the method developed by T. L. Brosseau, 8 it was possible to calculate the heat transferred to the gun tube. Three or more round replicates were fired for most modifications with temperature variations similar to those reported earlier. $^1,^2$ The greatest variation range in temperature for any thermocouple was 5K between rounds in a group. This range was seen in the thermocouple nearest the bore surface. The mean temperature of each thermocouple was used in plots of the products of temperature rise and radial distance to the thermocouple vs distance to the bore surface to compute heat input.

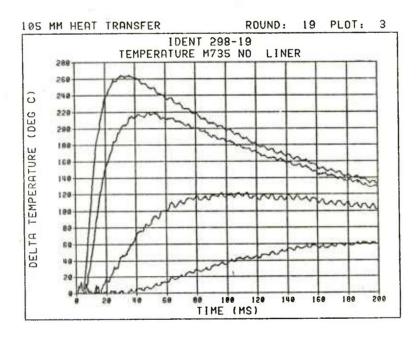


Figure 2. Temperature vs Time for Imbedded Thermocouples

⁸T. L. Brosseau, "An Experimental Method of Accurately Determining the Temperature Distribution and Heat Transferred in Gun Barrels", BRL Report No. 1740 (1974). (AD #B000171L)

TABLE 2. FIRING DATA 105 mm HEAT TRANSFER

Ident	Round	Liner	Position*	Purpose/Remarks
298-1	M392A2	TiO ₂	1 as RCD	Check out (Tape Malfunction)
298-2	M467	4.4		Clean out (Tape Malfunction)
298-3	M392A2	TiO ₂	1 as RCD	Check out
298-4	M467			Clean out
298-5	M735	Ta1c	2 as RCD	
298-6	M467			Clean out
298-7	M735	Ta1c	2 as RCD	
298-8	M467		0 000	Clean out
298-9	M735	Talc	2 as RCD	C1 can part
298-10	M467	m: O	1 DCD	Clean out
298-11	M392A2	TiO ₂	1 as RCD	Clean out
298-12	M467	T÷ O	1 oc DCD	Clean out
298-13	M392A2	\mathtt{TiO}_2	1 as RCD	Clean out
298-14 298-15	M467 M735	TiO ₂	1 as RCD	Clean out
298-15	M467	1102	1 as Nob	Clean out
298-17	M735	TiO ₂	1 as RCD	0.200.1000
298-18	M467	1102	1 455	Clean out
298-19	M735			No liner
298-20	M735	Ta1c	2 reglue	
298-21	M467		J	Clean out
298-22	M735	Talc	2 reglue	
298-23	M735			No liner
298-24	M735	Talc	2 reglue	
298-25	M467			Clean out (Tape Malfunction)
298-26	M467			Check out (Tape Malfunction)
298-27	M467			Check out
298-28	M735	Ta1c	1 reglue	
298-29	M467	- T		Clean out
298-30	M735	Ta1c	1 reglue	01
298-31	M467	m 1 -	1	Clean out
298-32	M735	Talc	1 reglue	Clean out
298-33	M467	T ÷ O	2 maglua	Clean out
298-34 298-35	M735 M467	\mathtt{TiO}_2	2 reglue	Clean out
298-36	Tape Test			oroan out
298-37	M735	TiO ₂	2 reglue	
298-38	M467	2	2 208200	Clean out
298-39	Tape Test			
298-40	M735	Talc	1 reglue	336°K
298-41	M467		•	Clean out
298-42	Tape Test			6
298-43	M735	TiO ₂	1 reglue	336°K
298-44	Tape Test	4		
298-45	M467			Clean out
298-46	M735	TiO ₂	1 reglue	336°K

 $^{^*}$ Position 1 and 2 shown in Figure 1.

TABLE 2: FIRING DATA 105 mm HEAT TRANSFER (Cont'd)

Ident	Round	Liner	Position*	Purpose/Remarks
298-47	M467			Clean out
298-48	M735	TiO ₂	1 reglue	336°K
298-49	M467	2		Clean out
298-50	M735	TiO ₂	2 reglue	336°K
298-51	M467	2 .		Clean out
298-52	M735	TiO ₂	2 reglue	336°K
298-53	M467	2		Clean out
298-54	M735	Talc	1 reglue	336°K
298-55	M467			Clean out
298-56	M392A2	TiO ₂	1 as RCD	336°K
298-57	M467	2		Clean out
298-58	M392A2	TiO_2	1 as RCD	336°K
298-59	M467	2		Clean out
298-60	M392A2	$Ti0_2$	1 as RCD	336°K
298-61	M467	2		Clean out
298-62	M735	TiO_2	1 as RCD	336° K
298-63	M467	2		Clean out
298-64	M735	TiO ₂	1 as RCD	336°K
298-65	M467	2		Clean out
298-66	M735	TiO ₂	2 reglue	
298-67	M467	2		Clean out
298-68	M490	TiO ₂	1 reglue	
298-69	M490	2	_	No Liner
298-70	M490	TiO_2	1 reglue	
298-71	M490	-		No Liner
298-72	M490	TiO ₂	1 reglue	
298-73	M490	2		No Liner
298-74	M392A2	TiO ₂	2 reglue	
298-75	M467	_		Clean out
298-76	M392A2	TiO_2	2 reglue	
298-77	M392	_		No Liner
298-78	M392A2	TiO ₂	2 reglue	No Flaps
298-79	M 3 92	-		No Liner
298-80	M392A2	TiO_2	2 reglue	No Flaps
298-81	M392	2		No Liner
298-82	M392A2	TiO ₂	2 reglue	No Flaps
298-83	M467	_		Clean out
298-84	M735	TiO_2	2 reglue	-
298-85	M467	_		Clean out
298-86	M735	TiO ₂	2 reglue	
298-87	M467		a nan	Clean out
298-88	M392A2	\mathtt{TiO}_2	1 as RCD	01
298-89	M467		1	Clean out
298-90	M392A2	TiO ₂	1 as RCD	Class out
298-91	M467	m: ^	1 - nan	Clean out
298-92	M392A2	\mathtt{TiO}_2	1 as RCD	

^{*}Positions 1 and 2 shown in Figure 1. 12

TABLE 2. FIRING DATA 105 mm HEAT TRANSFER (Cont'd)

Ident	Round	Liner	Position*	Purpose/Remarks
298-93	M467			Clean out
298-94	M735	Talc	2 reglue	
298-95	M467			Clean out
298-96	M735	Talc	2 reglue	•
300-1	M467		-	Clean out
300-2	M392A2	TiO ₂	2 reglue	No Flaps
300-3	M467	2		Clean out
300-4	M735	\mathtt{TiO}_2	2 reglue	

Several M392A2 rounds were fired to correlate this series of rounds with previous series of 105 mm firings. The effect of temperature conditioned rounds (294K vs 336K) was elucidated as well as the effect of substantially regluing the liners in the case. Table 3 shows the heat input results of the M392A2 rounds with comparison to previous tests, and the reduction caused by regluing the liners.

TABLE 3. HEAT TRANSFER - M392 ROUNDS

Round	Heat Input(J/mm)	Heat Input REF-2 (J/mm)	% Change from Standard Heat Input
M392A2 Standard TiO; M392 (No Liner) M392A2 Reglue TiO; M392A2 Standard TiO; 336K	451 357	381 449 - -	- +19 -6.1 +2.1

There was also a correlation made with reference 2 using M490 rounds without liners. The heat input measured in reference 2 was 471 J/mm and the heat input for this series was 476 J/mm. The glue effects for the M490 round can also be inferred. The M490 with a TiO₂/wax liner had a heat input of 421 J/mm in reference 2, while a similar liner in the same position, but reglued, had a heat input of 404 J/mm fired in this series.

The task of this investigation was to measure the heat input of the high loading density (6.05 kg M30) M735 round and recommend possible means of reduction of the total heat input. The possibilities of heat input reduction evaluated were types of wear reducing additives (TiO2 and talc), two positions of the liners (Figure 2) and the effect of substantially gluing the liners in place. It should be noted that substantially gluing the liners increases the residue in the cartridge case.

Positions 1 and 2 shown in Figure 1.

Figure 3 illustrates the residue effect. Case No. 1 is "as received" M392 revealing no trace of glue or liner material post firing. The No. 2 case in Figure 3 is an M735 that was reglued at the neck. There is glue residue and a small amount of liner residue. The No. 3 case in Figure 3 reveals a great deal more liner residue for the below the neck regluing in the M735 round. It is not surprising that the liner at the neck of the case would result in less residue because of increased combustion turbulence and flow velocity. It is somewhat surprising that the high residue reglued conditions would result in less heat input to the area of maximum erosion, since liner material left in the case does not work as wear reducing additive. This could be explained by the retention of the liner in the case resulting in more effective use of the liner during the entire combustion cycle. Perhaps more additive is applied to the bore instead of blowing the liner down tube.

Table 4 summarizes the results of the M735 tests at 294K. The effects of types of liners, position and glue are revealed as a percent reduction of total heat input from the no liner condition.

TABLE 4. M735 HEAT TRANSFER RESULTS 294K

Liner Type	Position from Figure 1	Heat Input (J/mm)	% Reduction
Without liner	<u>.</u>	47 7	e = %
TiO ₂ /wax*	1	431	10
TiO2/wax (reglued)) 2	375	21
Talc/wax	2	393	18
Talc/wax (reglued)) 2	371	22
Talc/wax (reglued		381	20

The M735 rounds were also evaluated at 336K. The no liner condition was not fired due to expected excess wear. The percent reduction of heat input shown in Table 5 is based on the TiO2/wax liner condition which is the standard M735 with a wear reducing liner. It is interesting to note that the percent reduction of the two cases were not as high as the percent reductions for the same modification of 294K. This can be explained

 $[^]st$ Standard M735 round with wear reducing additive.

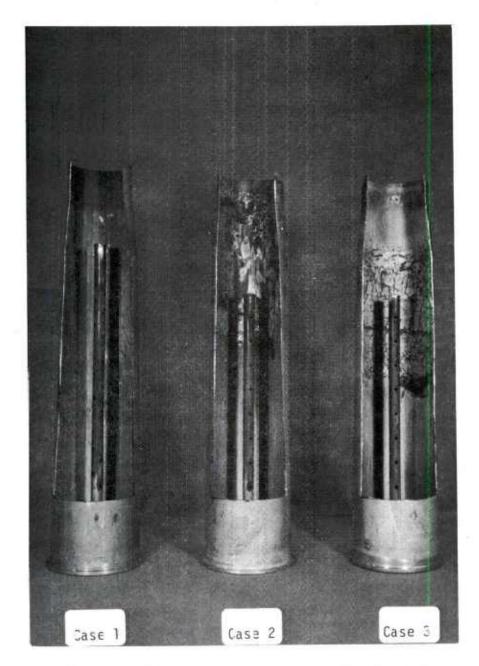


Figure 3. 105 mm Cartridge Cases after Firing

by the reduced effectiveness of the wear reducing liner at elevated temperatures. The reduced effectiveness has been observed in other $105~\mathrm{mm}^9$ and $155~\mathrm{mm}^{10}$ tests.

TABLE 5. HEAT TRANSFER RESULTS 336K

Liner Type	Position from Figure 1	Heat Input (J/mm)	% Reduction
TiO2/wax*	1	438	-
TiO2/wax reglued	1	410	6.4
TiO2/wax reglued	2	398	9.1

T. L. Brosseau derived an empirical formula that correlates heat transfer and muzzle velocity to gun tube wear.³ This method has proved quite accurate in predicting erosion rates for 105 mm firings that have full scale wear tests. However, as there have not been wear tests for the 105 mm gun with the M735 round, complete confidence in the empirical predictions is not possible. The predicted erosion rates for the M735 rounds at the various initial conditions are given in Table 6. Table 6 also contains an estimate of the wear life of the M68 gun for each M735 type based on a 1.91 mm (75 mil) condemnation wear criteria.¹¹ The number of rounds used for the wear life in Table 6 does not include the clean out rounds that would be required to fire each of the M735 rounds in a clean gun tube. Although there is some uncertainty with the empirical erosion prediction, the two orders of magnitude difference in wear rate between the no liner and the talc wax cases are significant results.

⁹P. R. Grepps, "Component Development Test of Swedish Barrel-Wear Reducing Additive for 105-mm, M68, Ammunition Components", DPS Report No. 838, March, 1963.

¹⁰D. S. Downs and L. E. Harris, "Relationship of Residue Formation to Wax Used in M203 Propelling Charge Liners", Technical Report No. ARLCD-TR-79042, December, 1979.

^{*}Standard M735 round with wear reducing additive.

¹¹ Research Test of Cannon, 105 mm, M68, Mechanism of Erosion, TECOM Test Agency, Report No. APG-MT-5294, September, 1979.

TABLE 6. PREDICTED EROSION RATES FOR M735
(AT 641.4 mm RFT)

Modification	Heat Input (J/mm)	Wear/rd (µm)	Condemnation Limit (rounds)
Without Liner	4 7 7	58.1	30
Talc/wax; Position 2	393	1.5	1300
Talc/wax; Position 2 reglued		.5	3820
Talc/wax; Position 1 reglued	381	.8	2 390
TiO2/wax; Position 2 reglued	375	.6	3180
TiO2/wax; Position 2 reglued; 336 K	398	2.3	830
TiO2/wax; Position 1 reglued; 336 K	410	4.0	480
TiO ₂ /wax; Position 1	438	14.0	140
TiO ₂ /wax; Position 1	L* 431	8.6	220

Table 7 gives the predicted erosion rates for the rounds other than M735 based on heat input and muzzle velocity. These wear rates are compared to actual wear measurements for the rounds where actual star gage wear tests were made.

TABLE 7. PREDICTED VS ACTUAL EROSION RATE (AT 641.4 mm RFT)

	easured Heat nput (J/mm)	Predicted Wear/rd (μm)	Actual Wear/rd (µm)**
M392 (No Liner)	451	20.2	18.0
M392A2 TiO2	380	0.8	1.07
M392A2 TiO2; reglued	3 5 7	0.2	-
M392A2 TiO2; 336 K	388	1.4	
M490 (No Liner)	476	56.3	-
M490; TiO2; reglued	404	2.5	-

^{*}Standard M735 round with wear reducing additive.

^{**} Reference 9.

IV. CONCLUSIONS

- 1. Heat transfer in the M68 tank cannon is reduced by wear-reducing additives.
- 2. The reduction in heat transfer is a strong function of the location and gluing technique of the wear reducing liner.
- 3. Regluing the liner of the M392 round with a substantial amount of glue further reduces the heat input to the gun tube.
- 4. The present position of the liner in the M735 results in an unnecessarily high and unacceptable heat input. The immediate solution to wear in the M735 round is to move the wear reducing liner to 25.4 mm from the neck of the case.
- 5. Further reduction in cannon wear can be anticipated by changing the method of gluing the liner in the case. Substantial gluing techniques have a significant effect on heat input to the gun tube. However, there will have to be consideration made for residue in the cartridge case if the gluing technique is changed.
- 6. The study of the M735 rounds should be expanded to determine the minimum heat input by firing several M735 rounds in succession. The question of secondary wear should also be addressed with liners near the neck of the case. It is believed that reducing erosion at the origin of rifling also reduces secondary wear, but this should be verified with a second series of thermocouples at the area of maximum secondary wear.

REFERENCES

- T. L. Brosseau and J. R. Ward, "Reduction of Heat Transfer in 105 mm Tank Gun by Wear-Reducing Additives", BRL MR 2698, Nov 1976. (AD #B015308L)
- 2. T. L. Brosseau and J. R. Ward, "Measurement of the Heat Input into the 105 mm M68 Tank Cannon Firing Rounds Equipped with Wear-Reducing Additives", BRL-TR-02056, April, 1978. (AD #A056368)
- 3. T. L. Brosseau, B. B. Grollman and J. R. Ward, "Empirical Formula Correlating Erosion and Heat Transfer", 1979 JANNAF Propulsion Meeting, Anaheim, CA, March 1979.
- 4. Based on star gaging, 19 Oct 1979, tube No. 24849.
- 5. "Evaluation of Cannon Tubes", Dept of Army Technical Manual, TM-9-1000-202-35, Nov 1969.
- 6. "Artillery Ammunition Master and Reference Chart", TECOM Report No. 1375, Nineteenth Revision, June 1978.
- 7. Private communication with J. O. Pilcher, BRL, September 1979.
- 8. T. L. Brosseau, "An Experimental Method of Accurately Determining the Temperature Distribution and Heat Transferred in Gun Barrels", BRL Report No. 1740 (1974). (AD #B000171L)
- 9. P. R. Grepps, "Component Development Test of Swedish Barrel-Wear Reducing Additive for 105-mm, M68, Ammunition Components", DPS Report No. 838, March, 1963.
- 10. D. S. Downs and L. E. Harris, "Relationship of Residue Formation to Wax Used in M203 Propelling Charge Liners", Technical Report No. ARLCD-TR-79042, December, 1979.
- 11. Research Test of Cannon, 105 mm, M68, Mechanism of Erosion, TECOM Test Agency, Report No. APG-MT-5294, September, 1979.

No. of Copies		No. of Copies	
12	Commander Defense Technical Info Center ATTN: DDC-DDA Cameron Station Alexandria, VA 22314		Commander US Army Armament Research and Development Command ATTN: DRDAR-LC, J. Frasier H. Fair J. Lannon
1	Director of Defense Research and Engineering ATTN: R. Thorkildsen The Pentagon Arlington, VA 20301		A. Bracuti A. Moss R. Walker Dover, NJ 07801
1	Director Defense Advanced Research Projects Agency ATTN: Dir, Materials Div 1400 Wilson Boulevard Arlington, VA 22209	6	Commander US Army Armament Research and Development Command ATTN: DRDAR-LC, J. Picard D. Costa E. Barrieres R. Corn K. Rubin
3	HQDA (DAMA-ARZ; DAMA-CSM; DAMA-WSW) Washington, DC 20301		J. Houle Dover, NJ 07801
1	Commander US Army Materiel Development and Readiness Command ATTN: DRCDMD-ST 5001 Eisenhower Avenue Alexandria, VA 22333	4	Commander US Army Armament Research and Development Command ATTN: DRDAR-LC, E. Wurzel K. Russell D. Downs R. L. Trask Dover, NJ 07801
2	Commander US Army Armament Research and Development Command ATTN: DRDAR-TSS Dover, NJ 07801	1	Commander US Army Armament Research and Development Command ATTN: DRDAR-QA, J. Rutkowski Dover, NJ 07801
5	Commander US Army Armament Research and Development Command ATTN: FC & SCWSL, D. Gyorog H. Kahn B. Brodman S. Cytron T. Hung Dover, NJ 07801	1	Commander US Army Armament Materiel Readiness Command ATTN: DRSAR-LEP-L, Tech Lib Rock Island, IL 61299

No. of Copies		No. of Copies	Organization
5	Director US Army ARRADCOM Benet Weapons Laboratory ATTN: I. Ahmad T. Davidson J. Zweig G. Friar		Commander US Army Electronics Research and Development Command Technical Support Activity ATTN: DELSD-L Fort Monmouth, NJ 07703
20	DRDAR-LCB-TL Watervliet, NY 12189	1	Commander US Army Missile Command ATTN: DRSMI-R
5	Director US Army ARRADCOM Benet Weapons Laboratory ATTN: J. Busuttil W. Austin R. Montgomery	1	Commander US Army Missile Command ATTN: DRSMI-YDL Redstone Arsenal, AL 35809
1	R. Billington J. Santini Watervliet, NY 12189 Commander	1	US Army Tank Automotive Research & Development Cmd ATTN: DRDTA-UL
	US Army Aviation Research and Development Command ATTN: DRSAV-E P. O. Box 209 St. Louis, MO 63166	1	Warren, MI 48090 President US Army Armor & Engineer Bd Fort Knox, KY 40121
1	Director US Army Air Mobility Research and Development Laboratory Ames Research Center Moffett Field, CA 94035	1	US Army Tank & Automotive Cmd 28150 Dequindre Road Warren, MI 48090
1	Commander US Army Research & Technology Laboratories ATTN: R. A. Langsworthy Fort Eustis, VA 23604	4	Project Manager Cannon Artillery Weapons Sys ATTN: DRCPM-CAWS US Army Armament Research and Development Command Dover, NJ 07801
1	Commander US Army Communications Rsch and Development Command ATTN: DRDCO-PPA-SA Fort Monmouth, NJ 07703	2	Project Manager - M110E2 ATTN: J. Turkeltaub S. Smith Rock Island, IL 61299

 of ies		No. of Copies	
1	Project Manager - XM1 Tank US Army Tank Automotive Development Command 28150 Dequindre Road Warren, MI 48090	_	Director US Army TRADOC Systems Analysis Activity ATTN: ATAA-SL, Tech Lib White Sands Missile Range NM 88002
1	Project Manager - XM1 Tank Main Armament Dev Div Dover, NJ 07801	1	Commander US Army Field Artillery School ATTN: J. Porter
1	Project Manager - ARGADS Dover, NJ 07801		Fort Sill, OK 73503 Commander
1	Commander US Army DARCOM Materiel Readiness Support Activity ATTN: DRXMD-ED Lexington, KY 40511	5	Naval Surface Weapons Center ATTN: M. Shamblen J. O'Brasky C. Smith L. Russell T. W. Smith
2	Director US Army Materials and Mechanics Research Center ATTN: J. W. Johnson K. Shepard Watertown, MA 02172	2	Dahlgren, VA 22448 Commander Naval Ordnance Station ATTN: L. Dickinson S. Mitchell Indian Head, MD 20640
3	Director US Army Research Office ATTN: P. Parrish E. Saibel D. Squire P. O. Box 12211 Research Triangle Park NC 27709	2	Commander Naval Ordnance Station, Louisville ATTN: F. Blume Louisville, KY 40202 AFATL (D. Uhrig, O. Heiney) Eglin AFB, FL 32542
1	Commander US Army Air Defense Center ATTN: ATSA-SM-L Fort Bliss, TX 79916	1	National Bureau of Standards Materials Division ATTN: A. W. Ruff Washington, DC 20234
1	Commander US Army Armor Center ATTN: ATZK-XM1 Fort Knox, KY 40121	1	National Science Foundation Materials Division Washington, DC 20550

No. of Copies		No. of Copies	Orga	anization
1	Battelle Columbus Laboratory ATTN: G. Wolken Columbus, OH 43201 Lawrence Livermore Laboratory ATTN: J. Kury Livermore, CA 94550	A U	Iniversity Dept of Aerospace Arrospace ATTN: H. I	of Illinois ronautics and e Engineering Krier
	Director Chemical Propulsion Info Agency Johns Hopkins University ATTN: T. Christian Johns Hopkins Road Laurel, MD 20810	у	L K	. Graves, Bldg. 400 . Barnhardt, Bldg. 400 . Jones, Bldg. 400 . Moody, Bldg. 525 COM
	Princeton University Forrestal Campus Library ATTN: Tech Lib B. Royce P. O. Box 710 Princeton, NJ 08540 Purdue University School of Mech Engineering	ï	D D D Dir, USAMS ATTN: D D G A	RSTE-AR RSTE-AD RSTE-TO-F AA RXSY-D RXSY-MP, H. Cohen Barnhardt, RAM Div Alexander, RAM Div ir Warfare Div
1	ATTN: J. R. Osborn W. Lafayette, IN 47909 SRI International Materials Research Center 333 Ravenswood Avenue Menlo Park, CA 94025	!	G R Dir, USACS	Fround Warfare Div AM Division L, Bldg. E3516 ORDAR-CLB-PA
	Hollio raik, on 54020			

USER EVALUATION OF REPORT

Please take a few minutes to answer the questions below; tear out this sheet and return it to Director, US Army Ballistic Research Laboratory, ARRADCOM, ATTN: DRDAR-TSB, Aberdeen Proving Ground, Maryland 21005. Your comments will provide us with information for improving future reports.

1. BRL Report Number
2. Does this report satisfy a need? (Comment on purpose, related project, or other area of interest for which report will be used.)
3. How, specifically, is the report being used? (Information source, design data or procedure, management procedure, source of ideas, etc.)
4. Has the information in this report led to any quantitative savings as far as man-hours/contract dollars saved, operating costs avoided, efficiencies achieved, etc.? If so, please elaborate.
5. General Comments (Indicate what you think should be changed to make this report and future reports of this type more responsive to your needs, more usable, improve readability, etc.)
6. If you would like to be contacted by the personnel who prepared this report to raise specific questions or discuss the topic, please fill in the following information.
Name:
Telephone Number:
Organization Address: